
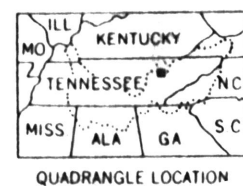
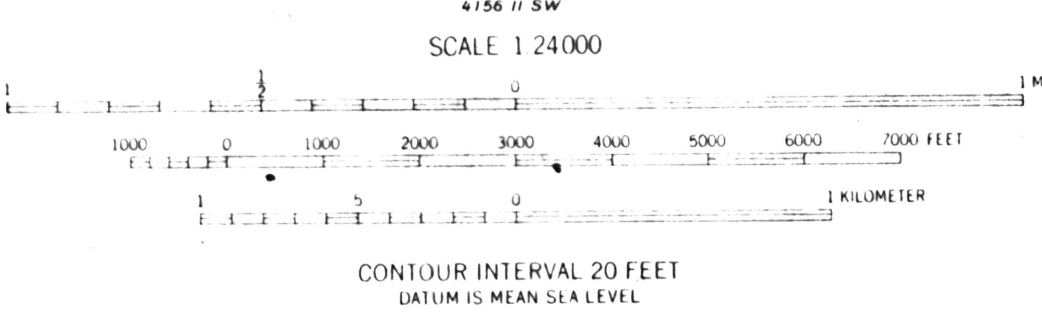


Mapped and edited by Tennessee Valley Authority
Published by the Geological Survey
Control by USC&GS, USGS, WPA, and TVA
Complete field revision by TVA 1952, using aerial photographs
taken 1952 and by reference to TVA USGS quadrangle dated
1947. Original map compiled by multiplex methods from
aerial photographs taken 1940.
Polyconic projection. 1927 North American datum
10,000 foot grid based on Tennessee rectangular
coordinate system.
— — — — — Indicates Norris Lake Easement Boundary
1000 meter Universal Transverse Mercator grid ticks

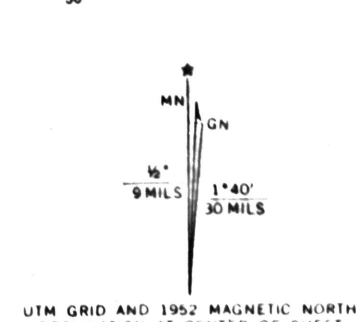

ROAD CLASSIFICATION
In developed areas, only through roads are classified
HARD SURFACE ALL WEATHER ROADS DRY WEATHER ROADS
Heavy duty ————— Improved dirt —————
Medium duty ————— Unimproved dirt —————
Loose surface, graded, or narrow hard surface —————
U.S. Route State Route
LAKE CITY, TENN.
N3607.5-W8407.5/7.5
1952

Landslides and related features interpreted
from aerial photographs:

1:80,000 (Black and White) 1976

Photointerpretation and field check, 1979-1980, 1982

This report is preliminary and has not
been reviewed for conformity with U.S.
Geological Survey editorial standards.

LANDSLIDES AND RELATED FEATURES

OF THE LAKE CITY, TENN. QUADRANGLE

by
Roger E. Thomas and Alfred R. Taylor

1982

U.S. Geological Survey
OPEN FILE MAP 82-653(B-15)

ACTIVE OR RECENTLY ACTIVE LANDSLIDE
Complex landslide composed of earthflow, debris
slide, earth and rock slump. Identified from
historical records, and from scars, debris and
other field evidence. Ground extremely unstable;
sliding accelerated by excavation, loading and
changes in drainage conditions. May include
areas with several active slides too small to
be shown separately. Questioned where doubtful.

OLD LANDSLIDE
Area of extensive hummocky ground caused by
earthflow and earth and rock slump. Lacks
clear evidence of active sliding. Relatively
stable in natural, undisturbed state,
generally not affected by small structures properly
sited in areas away from the edge of the toe;
can be reactivated by extensive, rapid excava-
tion, loading, and changes in ground water and
surface water conditions. Area of old landslide
probably includes recent ones not identified
from field evidence or otherwise documented.
Upslope boundary of landslide generally defined
by modified scarp, but downslope (toe) may be
gradational and not well defined. Questioned
where doubtful.

COMBINATION LANDSLIDE
Area of recent and old slides in which
individual slides are not identified.

COLLUVIAL SLOPE
Valley wall along major streams with slope as
steep as 40° (85%); stony, clayey silt soil up
to 50 ft. (15 m) thick; commonly buttressed by
a terrace or bench at the toe of the slope; very
susceptible to sliding by cutting of toe area,
removal of terrace or bench, and overloading;
slide commonly activated without apparent cause.

COLLUVIAL SLOPES WITH LANDSLIDES
Landslides too small or obscure to map
individually.

**AREAS SUSCEPTIBLE TO DEBRIS FLOWS AND DEBRIS
AVALANCHES**
Primarily shallow, narrow ravines and chutes with
accumulation of stony colluvium generally 10 ft.
(3 m) or less in thickness; susceptible to rapid
movement during intense rainfall. Most ravines
and chutes designated show evidence of former
debris flows and avalanches.

AREAS SUSCEPTIBLE TO ROCKFALL
Steep, locally vertical, natural and man-made
slopes and cliffs, 15 ft. (4.5 m) or more high;
formed dominantly of sandstone, limestone, sandy
shale, mudstone and claystone. Interbedded mud-
stone, claystone and shale weather rapidly leaving
sandstone and limestone rock faces unsupported.

SOIL AND ROCK SUSCEPTIBLE TO LANDSLIDING
Soil and rock similar to that involved in land-
slides elsewhere in map area; primarily areas
underlain by claystone, mudstone and shale
associated with other rock types. Rock weathers
rapidly on exposure forming clayey soil highly
susceptible to sliding. Includes coves (U-shaped,
shallow valleys) containing thick layers of clayey
soil that are very susceptible to sliding where
excavation breaks continuity of slope and where
overloaded by artificial fill.

AREAS LEAST PRONE TO LANDSLIDES
Map areas in which no patterns or symbols are shown;
primarily valley floors, ridge tops and broad
benches; modification by excavation and fill may
lead to local landslides.

The first five digits of the open file number designate the
specific 1:250,000 scale map sheet of which this quadrangle
is a part. The last two digits designate the position of the
quadrangle in a subdivision of the 1:250,000 scale map based
on rows and tiers shown in the diagram to the right. The
location of this quadrangle is shown by the black square.

NOTE
Information shown is intended as a
general guide to ground conditions as of
the date of field check. Additional
landslides and rockfalls should be anticipated
in all map units. The map unit depicts
the dominant condition in the area delineated
and variations in slope stability may occur
at any point in the unit. This map is suit-
able for general planning purposes and as a
supplement to more detailed studies for site
selection. The map cannot be used as a sub-
stitute for detailed geologic and engineering
investigations to establish design and
construction criteria of specific sites.
Some symbols may not appear on this map
because the description is applicable to a
series of maps.

MAN-MADE FEATURES
Strip mines (combination of letter symbols
indicates complex formed of more than one
type of strip mine)
sh bench with high wall
sf furrowed with high wall
sd multiple furrows and multiple benches
ss hilltop removed
sr reclaimed by grading
sru reclaimed by secondary use
sh/r regraded in part, high wall
remains
Coal refuse banks
r identified on aerial photographs;
not classified in field check
rb not burnt nor on fire
rbb burnt

Quarries
q quarry site
Gravel pits
g site of gravel pit
Slides in man-made features
af earth flow in fill
a/s earth flow in strip castings
a/r earth flow in coal refuse

